


TROUBLESHOOTING

RLM XTREME

- LOOM
Lamp does not fit (too loose)
Retro fit seal (**90007090**) & IOM available, contact your distributor
- LOOM or component is broken (contact RMA@uvresources.com)
Replace entire LOOM (**55008022**)
Replace the lamp connection portion (**55008001**)
Replace lamp compression nut (**55000191**)
Replace lamp holder nut (**55000192**)
- Lamp is on but indicator light is not on (from X-BOX)
CU2 malfunction – replace CU2 (**90004044** – 4pk)
- Need to replace power supply
Advanced ballast - **55800031**
M12 connector ballast - **90002890**
- Need to replace contact controller - **90001526**
- Need to replace IP67 lampConnector cable
SA VERSION **55000180** (GREEN GASKET)
UVR VERSION **55000170** (BLUE GASKET)
- Have multiple X-BOX with multiple access door. How do I wire them?
Contact techsupport@uvresources.com

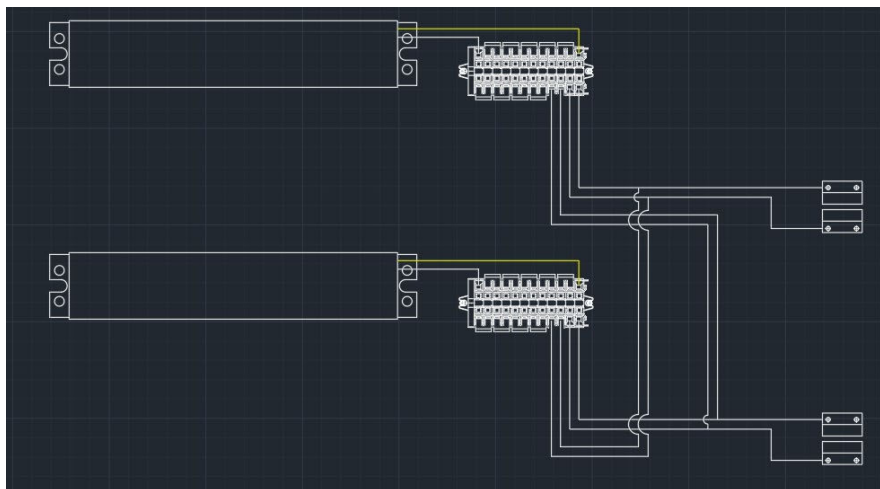

FOR FURTHER ASSISTANCE: techsupport@uvresources.com